



UNIVERSITI PUTRA MALAYSIA

**DEVELOPMENT OF ULTRASONIC TECHNIQUE FOR DETECTION
OF DECAY IN WOODEN CROSS-ARMS**

LAI SOOK KEAN

FSAS 2002 44

**DEVELOPMENT OF ULTRASONIC TECHNIQUE FOR DETECTION OF
DECAY IN WOODEN CROSS-ARMS**

**By
LAI SOOK KEAN**

**Thesis Submitted to the School of Graduate Studies, Universiti Putra Malaysia,
in Fulfillment of the Requirement for the Degree of Master of Science**

May 2002



Dedicated to My Parent and Family Members... ..

Abstract of thesis presented to Senate of Universiti Putra Malaysia in fulfillment of the requirements for the degree of Master of Science.

**DEVELOPMENT OF ULTRASONIC TECHNIQUE FOR DETECTION OF
DECAY IN WOODEN CROSS-ARMS**

By

LAI SOOK KEAN

May 2002

Chairman : Professor Dr. Kaida bin Khalid

Faculty : Science and Environmental Studies

A simple, economic, and accurate nondestructive measurement method has been developed to determine the quality of in-service wooden cross-arms. A wooden cross-arm is part of the pylon normally used to support high-power transmission line. The measurement system uses an ultrasonic pulse, 45kHz, to propagate from transmitter to receiver. The transit time of the pulse is the basic parameter. Investigations show that the transit time is dependent on the distance between two transducers and needs a continuum medium. Other factors such as density, moisture content, fiber direction, continuity of the medium, and sample thickness also influence the propagation of ultrasound. An investigation has been done to find out the optimum condition for detection methods. The optimum condition was determined through various experimental methods such as C-Method, Upper Method, Direct Method, Indirect Method, and Semi-Direct Method.

The investigation found that C-method is the best method to be used for wooden cross-arms decay detection. This method is able to detect the decay of the wood under the metal block, which is impossible by using microwave method. The transit times for

sound wood, old wood, and cracked wood fall under the ranges of 100 μ s to 200 μ s, 200 μ s to 500 μ s, and above 500 μ s respectively. Most of the measured results for cracked wood are above detection time limit of the device and the signal is normally very weak. The experimental results also showed that for moisture content ranging from about 10% to 30% in the wood, there is not much effect in the transit time. This range of moisture content corresponds to the moisture that can be absorbed by Chengal wood during rainy day. Most of the measurement of transit time is done in the L-L direction. It was found out that the velocity along the L-T direction is about 500ms⁻¹. The propagation along this direction, which is parallel to the fiber direction, is 3 times higher than the T-R or R-R directions.

To complete the study, a prototype has been developed, which can be used for field-testing or maintenance work. This prototype is light, portable, easy to use, safe, and reliable.

Abstrak tesis yang dikemukakan kepada Senat Universiti Putra Malaysia sebagai memenuhi keperluan untuk ijazah Master Sains.

**PERBINAAN ULTRASONIK TEKNIK UNTUK PENGESANAN PEREPUTAN
PADA PALANG LENGAN KAYU**

Oleh

LAI SOOK KEAN

Mei 2002

Pengerusi : Profesor Dr. Kaida bin Khalid

Fakulti : Sains dan Pengajian Alam Sekitar

Satu kaedah pengukuran tanpa musnah yang ringkas, ekonomi, tepat dan mudah telah dibinakan untuk menentukan kualiti palang lengan kayu. Palang lengan kayu ini adalah sebahagian dari pylon yang digunakan untuk menyokong talian penghantaran kuasa tinggi. Sistem pengukuran menggunakan pemancaran denyut ultrasonik berfrekuensi 45kHz dari penghantar ke penerima, dengan masa penghantaran dianggap sebagai parameter asas. Kajian telah menunjukkan bahawa masa penghantaran adalah bergantung kepada jarak di antara kedua-dua transduser dan memerlukan satu medium kontinu. Faktor-faktor lain juga mempengaruhi pemancaran ultrasonik ini seperti ketumpatan, kelengasan, arah serabut, keselajaran medium dan ketebalan sampel. Kajian telah dibuat untuk mendapatkan syarat optimum bagi kaedah pengesanan palang lengan kayu seperti Kaedah-C, Kaedah-Atas, Kaedah Langsung, Kaedah Tak Langsung dan Kaedah Semi-Langsung.

Kajian mendapati bahawa Kaedah-C adalah kaedah yang terbaik untuk pengesanan kereputan palang lengan kayu. Kaedah ini dapat digunakan untuk mengesan kereputan

kayu dibawah blok logam yang tidak mungkin dapat dikesan menerusi gelombang mikro. Masa penghantaran bagi kayu sempurna, kayu lama dan kayu retak masing-masing adalah dalam lingkungan dari 100 μ s hingga 200 μ s, dari 200 μ s hingga 500 μ s dan melebihi 500 μ s. Kebanyakan hasil pengukuran bagi kayu retak adalah melebihi had masa pegesanan peralatan dan isyaratnya sangat lemah. Keputusan kajian ini juga menunjukkan bahawa kandungan kelengasan dalam lingkungan dari 10% hingga 30% dalam kayu, kurang mempengaruhi masa penghantaran. Julat kelengasan ini adalah kelengasan yang diselang oleh kayu Chengal semasa hari hujan. Kebanyakan kajian bagi masa penghantaran adalah dalam arah L-L. Didapati bahawa sepanjang arah L-T jalaju ultrasonik adalah dalam lingkungan 500ms⁻¹. Pemancaran sepanjang arah ini yang selari dengan arah serabut adalah 3 kali ganda lebih tinggi daripada arah T-T dan R-R.

Bagi melengkapkan kajian satu prototaip dibina untuk digunakan bagi pengujian di lapangan (*field testing*) atau kerja penyelenggaraan.. Prototaip ini adalah ringan, mudah alih, mudah digunakan, selamat dan boleh dipercayai.

ACKNOWLEDGEMENTS

First of all, I would like to express my heartfelt gratitude and appreciation to Prof. Dr. Haji Kaida Khalid, the chairman of the supervisory committee, and to other members of the committee, Associate Prof. Dr. Mohd. Hamami bin Sahri, and Associate Prof. Dr Sidek bin Hj. Ab. Aziz for the contribution of their knowledge and valuable advise for my project. I would also like to thank Mr. Roslim Mohd, Lab Assistant of Physics Department, for his talents and time in teaching me the practical knowledge related to my project.

I would also like to take this opportunity to thank my friend, Mr. Sim Lim Hai, my sister Lai Poh Yean, my family and friends, who gave their supports and encouragement while I was doing my project.


I certify that an Examination Committee met on 7th May 2002 to conduct the final examination of Lai Sook Kean on her Master of Science thesis entitled "Detection of Decay in Wooden Cross-Arm using Ultrasonic Sensor" in accordance with Universiti Pertanian Malaysia (Higher Degree) Act 1980 and Universiti Pertanian Malaysia (Higher Degree) Regulations 1981. The Committee recommends that the candidate be awarded the relevant degree. Members of the Examination Committee are as follows:

Abdul Rahman Ramli, Ph.D.
Faculty of Engineering,
Universiti Putra Malaysia
(Chairman)

Kaida Khalid, Ph.D.
Professor,
Faculty of Science and Environmental Studies
Universiti Putra Malaysia
(Member)

Sidek Abdullah Aziz, Ph.D.
Associate Professor,
Faculty of Science and Environmental Studies
Universiti Putra Malaysia
(Member)

Hamami Sahri, Ph.D.
Associate Professor,
Faculty of Forestry
Universiti Putra Malaysia.
(Member)

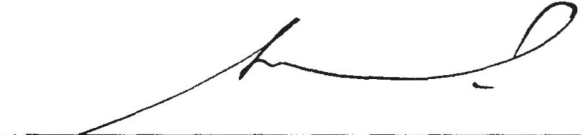

SHAMSHER MOHAMAD RAMADILI, Ph.D.
Professor/ Deputy Dean
School of Graduate Studies,
Universiti Putra Malaysia.

Date: 16 JUL 2002

This thesis submitted to the Senate of Universiti Putra Malaysia has been accepted as fulfillment of the requirements for the degree of Master of Science.

AINI IDERIS, Ph.D,
Professor / Dean
School of Graduate Studies,
Universiti Putra Malaysia

Date:

DECLARATION

I hereby declare that the thesis is based on my original work except for quotations and citations, which have been duly acknowledged. I also declare that it has not been previously or concurrently submitted for any other degree at UPM or other institutions.

(LAI SOOK KEAN)

Date:

TABLE OF CONTENTS

	Page
DEDICATION.....	ii
ABSTRACT.....	iii
ABSTRAK.....	v
ACKNOWLEDGEMENTS.....	vii
APPROVAL SHEETS.....	viii
DECLARATION FORM.....	x
LIST OF FIGURES.....	xiv
LIST OF PLATES.....	xvii
LIST OF SYMBOLS AND ABBREVIATIONS.....	xix
I GENERAL INTRODUCTION.....	1
Introduction.....	1
Current NDE Methods of Decay Detection.....	5
The Stress Wave Method.....	6
Radiography.....	6
Microwave Technique.....	7
Ultrasonic Inspection.....	8
Drill Resistance.....	8
Important Factors for Wood Detection.....	9
Objectives.....	10
Summary.....	11
II DETECTION OF DECAY USING NONDESTRUCTIVE EVALUATION WITH ULTRASONIC TECHNIQUE.....	12
Introduction.....	12
Chengal.....	12
Anatomy of Chengal.....	16
Application of Chengal in Heavy Construction.....	18
The Relationship between the Moisture Content and Wood Problems.....	19
Fiber direction and MC.....	21
Types of Decay.....	22
Internal Decay.....	22
External Decay.....	23
Nondestructive Evaluation (NDE).....	24
Ultrasonic.....	25
History and application of Ultrasonic Technique.....	25
Particle Motion and Sound Wave.....	28
Attenuation and Scattering.....	30
Piezoelectric Transducer.....	31
Ultrasonic Through Transmission Method.....	35
Orthotropic Nature of Wood.....	36



Environmental Effect.....	37
Basic Definition.....	37
Transit time.....	37
Density of Wood.....	38
Moisture Content of Wood.....	38
Fiber Direction.....	38
Pulse Velocity.....	40
Degradation Ratio.....	40
Wave Propagation in Anisotropic Media.....	41
Ultrasonic Bulk Wave Propagation in Orthotropic Media.....	44
Summary.....	50
III EXPERIMENTAL METHODOLOGY.....	51
Introduction.....	51
The Measurement Method.....	51
The Measuring System Description.....	52
Calibration of Ultrasonic Instrument-BPV.....	55
Measuring Range and Accuracy.....	56
Experimental Set-Up.....	56
Transducer.....	57
Field Test Setting.....	58
Measurement Methods.....	60
Upper Method.....	61
C-Method.....	61
Measurement Description.....	61
Calibration.....	62
Measurement.....	62
Direct Method.....	62
Semi-Direct Method.....	62
Indirect Method.....	63
Samples Preparation and Description	63
Wood Properties Study.....	63
Different Moisture Content Percentage (MC%).....	64
Decay Level Determination.....	65
Method of Measurement.....	66
Determination of End-Joint Defect.....	66
Thesis Organization.....	67
IV RESULTS AND DISCUSSION.....	68
Introduction.....	68
General Result.....	68
Velocities Detected for Various Species of Wood at Longitudinal, Tangential and Radial Direction.....	68
The Effect of Moisture Content for Chengal and Kempas Wood...	70
Determination of the Decay Level for Chengal Wood Block.....	73
Determination the Partially Decayed Wood by Using Transit Time.....	73

Determination the Severely Decayed Wood by Using Transit Time.....	73
Determination the Partially Decayed Wood by Using Degradation Percentage.....	74
Determination the Severely Decayed Wood by Using Degradation Percentage.....	75
Chengal Sound Wood Without Metal Plate.....	76
Direct Method.....	76
Indirect Method.....	77
Semi-Direct Method.....	78
Direct Method with Aluminum Plate.....	80
Detection for the Whole End-Joint with Direct Method.....	81
Detected AB Area.....	81
Detected CD Area.....	82
Detected EF Area.....	82
Detection for the Whole End-Joint with Semi-Direct Method.....	88
Upper Method.....	88
C-Method.....	89
Summary.....	93
V CONCLUSION.....	94
Introduction.....	94
Development of Portable Type Sensor Holder.....	94
The Advantages of C-Method.....	95
General Conclusion.....	96
Recommendation and Future Work.....	98
REFERENCES.....	100
APPENDICES.....	104
Appendix I.....	105
Appendix II.....	114
VITA.....	117

LIST OF FIGURES

Figure		Page
1.1	The Structure of the Power Tower for 500kV, 237kV and 132kV.....	2
2.1	The Structure of a Hardwood in 3-Dimensional Perspective	17
2.2	Variation in the Moisture Content of Wood with Changes in Atmospheric Relative Humidity.....	20
2.3	Acoustic Frequency Scale (Cracknell, 1980).....	26
2.4	Particle Motion During the Passage of a Plane Longitudinal Wave.....	29
2.5	Particle Motion During the Passage of a Plane Transverse or Shear Wave.	29
2.6	The Phenomena for the Pulse Penetrated into a Medium with Defect or Crack from Transmitter to Receiver.	31
2.7	The Inner Structure of a Transducer and Consist Eight Pieces of PZT Thin Disk.	32
2.8	The Pulse Emitted with Sound Pressure, P (1-dimensinal) by a Circular Element of Diameter, d.....	33
2.9	The Sound Pressure in Piston Pattern Propagating in Z-Direction (3-Dimensional View).....	33
2.10	Loading, Emission and Reception Time, of the Piezoelectric Transducers for Ultrasonic Wood Applications.	34
2.11	Reference for Fiber Direction of Wood with Symbol L, T and R is Longitudinal, Tangential and Radial Respectively.....	36
2.12	Illustration from Wood Fiber Direction.....	39
2.13	Ultrasonic Velocities in an Orthotropic Solid. Longitudinal Waves: $V_{11} = V_{LL}$, $V_{22} = V_{RR}$, $V_{33} = V_{TT}$ Transverse Waves: $V_{44} = V_{RT}$, Deduced from V_{23} and V_{32} ; $V_{55} = V_{LT}$, Deduced from V_{13} and V_{31} ; $V_{66} = V_{LR}$, Deduced from V_{12} and V_{21}	43
3.1	Block Diagram for the BPV.....	52
3.2	Adjustment with the Conical Probes on the Calibration Block $10\mu s$	55

3.2	Adjustment with the Conical Probes on the Calibration Block 10 μ s.....	55
3.3	Experimental Set-Up for Wood Measurement Using the Through Transmission Method.....	57
3.4	Measurement Methods: a) Direct Method, b) Semi-Direct Method, and c) Indirect Method.....	60
4.1	Detected Velocity is Measured for 15 Species Using Thick Samples (More Than 3cm Thickness) at Various Densities and for Three Direction, Longitudinal, L, Radial, R and Tangential, T.....	69
4.2	Detected Velocity is Measured for 58 Species Using Thin Samples (1cm Thickness) at Various Densities and for Three Direction, Longitudinal, L, Radial, R and Tangential, T.....	69
4.3	Transit Time Against Various Moisture Content for Chengal Wood.....	71
4.4	Transit Time Against Various Moisture Content for Kempas Wood.....	71
4.5	Comparison of Transit Time Against Length of Sound Wood and Partially Decayed Wood.	72
4.6	Comparison of Transit Time Against Length of Sound Wood and Severely Decayed Wood.....	72
4.7	Partially Decayed Wood Detected in Radial Direction by Using Direct Method.....	74
4.8	Severely Decayed Wood Detected in Radial Direction by Using Direct Method.....	75
4.9	Chengal Sound Wood was Detected with Direct Method.....	76
4.10	Chengal Sound Wood was Detected with Indirect Method.....	78
4.11	Chengal Sound Wood was Detected with Semi-Direct Method.....	79
4.12	Chengal Sound Wood was Detected, a Hole Covered with Aluminum Plate by Using Direct Method.....	80
4.13	Detected End-Joint with Metal-Wood-Metal (AB) Area by Using Direct Method as Shown in Figure 4.15.....	81
4.14	End-Joint Simulated from Plate 1.1. The Label AB is Metal-Wood-Metal. CD is Metal-Air-Metal, and Whole End-Joint wills Detect Along the EF. [is the C-Method Detected Area.....	83

4.15	Detected End-Joint with Metal-Air-Metal (CD) Area by Using Direct Method.....	84
4.16	Detected The Whole End-Joint (EF) Area by Using Direct Method.....	84
4.17	Set-Up for Upper Method Measurement (Side View).....	85
4.18	Set-Up for Upper Method Measurement (Top View).....	86
4.19	Transit Time Detected for Sound Wood, S, Old Wood, O, and Cracked Wood, C by Using Upper Method. Graph A, B, C, D, and E Correspond to the Measurement Lines in Figure 4.18	87
4.20	Set-Up for C-Method Measurement.....	89
4.21	End-Joint With Crack.....	90
4.22	Transit Time Detected for Sound Wood, S, Old Wood, O, and Cracked Wood, C by Using C - Method. Graph A, B, C, D, and E Correspond to the C – Shape in Figure 4.20.....	91

LIST OF PLATES

Plate		Page
1.1	The End-Joint of the Power Tower. The Worker is Doing Inspection for the Wooden Pole Quality Situation.....	4
1.2	A Worker Doing Inspection for the End-Joint of the Power Tower (Maintenance Work).....	5
2.1	Chengal Tree.....	13
2.2	The Structure of Wood from a Hardwood Species, <i>Robinia pseudoacacia</i>	15
2.3	Leaves and Seeds of Chengal	15
2.4	Planes of Wood. Longitudinal Direction, Tangential Direction and Radial Direction Identified with L, T and R Respectively	17
2.5	Cross-Section of Chengal	18
2.6	Power Tower with 132kV.....	19
2.7	This Piece of Chengal Woodblock from an End-Joint of Cross-Arm has been Used for More then 15 Years.....	22
2.8	The Decay of a Wooden Cross-Arm.....	24
3.1	Ultrasonic Tester BPV, Frequency 45kHz.....	56
3.2 (a)	Prototype.....	58
3.2 (b)	Field Test Setting.....	58
3.3	Sensor Holder and Ultrasonic Tester (BPV).....	59
3.4	Sensor Holder is able to Bend into Half (Side View).....	59
3.5	Various Species of Wood, a) Thin Wood (1cm in Thickness), and b) Thick Wood (3-5cm in Thickness).....	64

3.6	Chengal Woodblock of Size Measuring about 12.5cm x 12.5cm x 3.0cm, a) Sound Wood, b) Partially Decayed Wood, and c) Severely Decayed Wood.....	65
3.7	Chengal Sound Wood Bar with Size 12.5cm x 12.5cm x 60.0cm.....	66
3.8	Sample End-Joint with Metal Plate, a) Old Wood End-Joint, and b) End-Joint with Crack.	67

LIST OF SYMBOLS AND ABBREVIATIONS

BaTi	Barium Titanate
Γ_{ik}	Chirstoffel Tensor
C	Crack Wood
D%	Degradation Percentage
ρ	Density, kgm^{-3}
C_{ijkl}	Elastic Constants
C_{LL}	Elasticity for Longitudinal
C_{RR}	Elasticity for Radial
C_{TT}	Elasticity for Tangential
EMC	Equilibrium Moisture Content
FSP	Fiber Saturation Point
δ_{ik}	Kronecker Delta
PMN	Lead Metaniobate
PZT	Lead Zirconate Titanate
MOE	Modulus of Elasticity
MOR	Modulus of Rapture
MC	Moisture Content
MC%	Moisture Content Percentage
NDE	Nondestructive Evaluation
O	Old Wood (Serviced Wood)

λ	Poisson's Ratio
P_m	Polarization Vector
V	Pulse Velocity, ms^{-1}
S	Sound Wood
$[\epsilon_{kl}]$	Strains Tensor
$[\sigma_{ij}]$	Stress Tensor
TNB	Tenaga Nasional Berhad
t	Transit Time, μs
x	Length, cm
\ddot{u}_j	Displacement
A_o	Amplitude of the Wave
P_i	Unit Displacement Polarization Vector
k_m	Wave Vector Component Along the χ_m
χ_m	Position Vector
n_k	Direction Cosines
ω	Angular Frequency

CHAPTER I

GENERAL INTRODUCTION

Introduction

Wood can be considered as a biological substance, which is widely used in many industries due to its complex structure and durability. In a microscopic overview, the wood composite is formed in a discrete scale level to assure its high performance against different environmental conditions such as strong wind and heavy rain.

In Malaysia, wood poles and wooden cross-arms are used as line supports for power pylon towers. The design, the construction of transmission lines and wood poles for power line supports are done by Tenaga Nasional Berhad (TNB). The transmission lines are divided into three major categories: 500kV, 257kV, and 132kV, as shown in Figure 1.1. The End-Joint of a tower is constructed with a wooden cross-arm. For commercial plantations (the private sector), wood poles are used as power line supports, instead of the costly concrete or galvanized iron line supports now in use (Hussein, 1998).

The most popular uses of heavy hardwoods in this country are for heavy constructions such as wooden houses, railway sleepers, timber bridges, and power line poles based on the woods' natural durability. By far Chengal is the most popular hardwood fit for the above purposes.

The hot and humid climate in tropical countries like Malaysia facilitates the growth of fungi and other destructive microorganisms in wooden structures. Thereby, deterioration of wooden structures occurs. It takes the forms of splits, cracks, and other defects that permit the entry of fungi into the cores of the poles, rendering them unsuitable for use as line supports. For wooden structures, this nature of degradation or deterioration can inhibit the performance of the entire structure.

Hence, wooden cross-arms inspection and maintenance are essential for the following reasons:

- i) Safety to life and property: wooden cross-arms should be maintained above definite minimum strength requirements. The strength value of each species of wood is different from others. The minimum strength requirements according to species of wood have been chosen for intelligent applications of woods.
- ii) efficient service within the system: outages or service interruption due to pole failures should be kept to a minimum. For examples, mechanical damage may lead to a reduction in the useful life of a wooden cross-arm, and maintenance works that leave some holes after testing (quasi nondestructive method) the wooden quality condition may also lead to degradation of wood.

- iii) economical operation: the number of wooden cross-arm replacements should not be excessive and the maximum useful life should be obtained from every wooden cross-arm.

Plate 1.1 shows a worker doing inspection for the end-joint of a power tower. The maintenance work is very dangerous. So, a simple method to be used for this purpose is essential. The most currently used nondestructive evaluation (NDE) methods to detect the wood defects are by vibration technique (traditional method), sonic stress wave technique, microwave technique, radiation (X-ray and gamma ray), visual inspection, and drill resistance (MC Master, 1982). As every technique has different advantages of its own for various wood defect detection condition, a simple, fast, safe, and accurate technique must be developed.

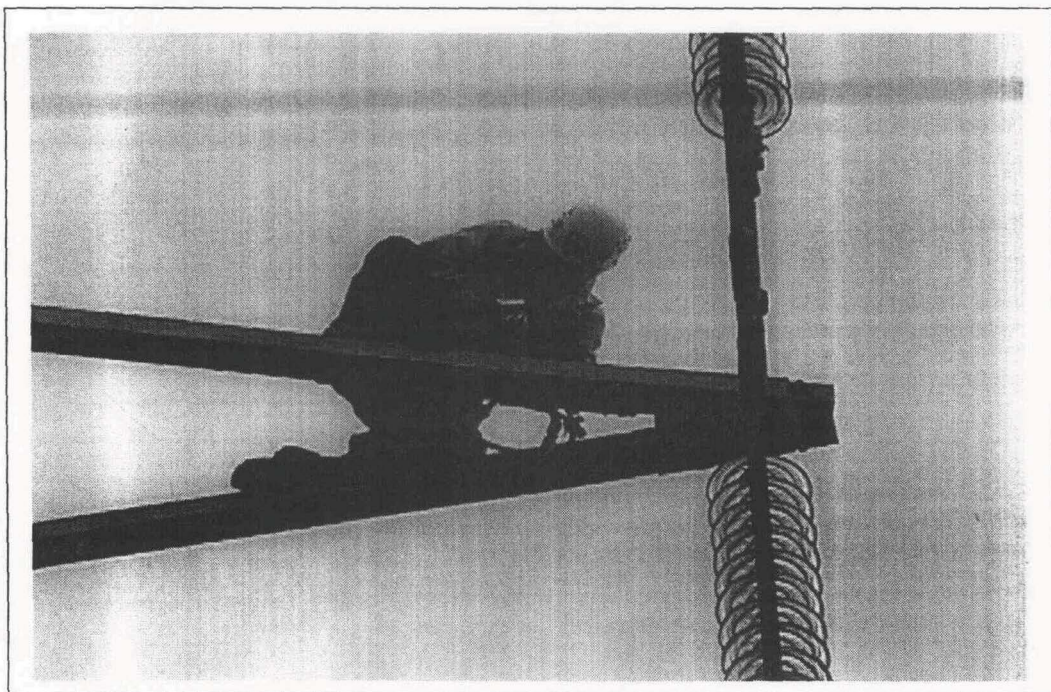


Plate 1.1: The End-Joint of a Power Tower. The worker is doing inspection for the Wooden Pole Quality Situation.